

Section Inspection - 11/05/2026 - Unknown Chamber- C-HW256

11/05/2026	1:53 PM	Land Ownership	Pipe Asset ID	Nr.
Project name	Contractor's Job Number	Coding Standard	Unknown Chamber- C-HW256	7
		WSA 05-2020	Name of operator	Job ID
				01

Town	US MH	Unknown chamber	Unit Length	0.00 m
Address	Direction	Upstream	GIS length	0.00 m
Location Type	DS MH	C-HW256	Inspected Length	91.62 m
Operation	Use	Drain	Year Laid	
Profile	Purpose of inspection	Operational Condition Inspection		
Lining Material	Method of inspection	Television Camera		
Lining Type	Precipitation	No precipitation		
Dia/Height	Cleaning	Preclean		
Material	Flow control	No measures taken		
General comment				

1:583	m+	Code	Observation Text	Grade
C-HW256	0.00	STO	Start node, outfall, Nodename:, C-HW256	
	0.00	WLC	Water level, clear flow (the invert is visible), water level: 0%	
	3.11	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	13.95	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location photo	
	20.23	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	25.21	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	30.04	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	35.15	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	39.91	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	44.87	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock	
	49.83	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	55.83	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	60.82	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	
	64.55	BD	Breaking, all pieces are present but some of them are visibly displaced from position, at joint, length of break: 100mm from 12 o'clock to 12 o'clock / Inside	4
	64.55	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark	



STO - 0.00



WLC - 0.00



GPFH - 3.11



GPFH - 13.95



GPFH - 20.23

Section Inspection - 11/05/2026 - Unknown Chamber- C-HW256

11/05/2026	1:53 PM	Land Ownership	Pipe Asset ID	Nr.
Project name	Contractor's Job Number	Coding Standard	Unknown Chamber- C-HW256	7
		WSA 05-2020	Name of operator	Job ID
				01

1:583	m+	Code	Observation Text	Grade	
	69.41	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark		
	71.91	BD	Breaking, all pieces are present but some of them are visibly displaced from position, at joint, length of break: 100mm from 12 o'clock to 12 o'clock	4	
	74.29	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 1 o'clock / Location mark		
	79.17	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock		
	84.01	FC	Circumferential fracture, at joint, width: 2.195mm from 12 o'clock to 12 o'clock	2	
	84.01	GPFH	General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark		
	91.62	FHZ	Finish node, Nodename:, Unknown Chamber / Sealed chamber with no manhole lid		
					
					
					
					
					
					
					
					

Section Inspection - 11/05/2026 - Unknown Chamber- C-HW256

11/05/2026	1:53 PM	Land Ownership	Pipe Asset ID	Nr.
Project name	Contractor's Job Number	Coding Standard	Unknown Chamber- C-HW256	7
		WSA 05-2020	Name of operator	Job ID
				01



GPFH - 74.29



GPFH - 79.17



FC - 84.01



FC - 84.01



GPFH - 84.01




FHZ - 91.62


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Defects				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
3	50.0	1.2	108.0	4	0	0.0	0.0	0.0	1

Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

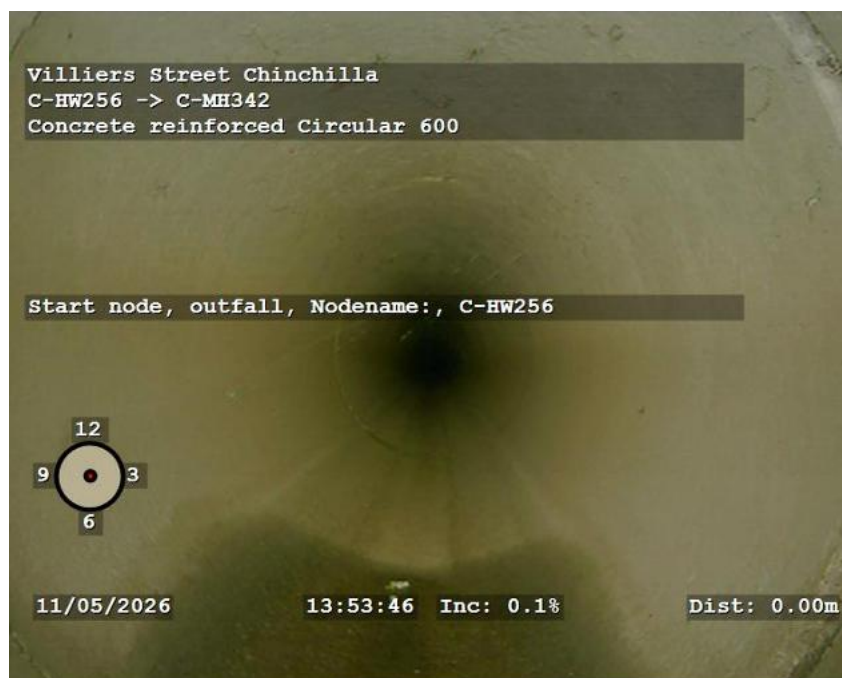


1288411052026 15347 PM.jpg, 00:00:00, 0.00
Start node, outfall, Nodename:, C-HW256

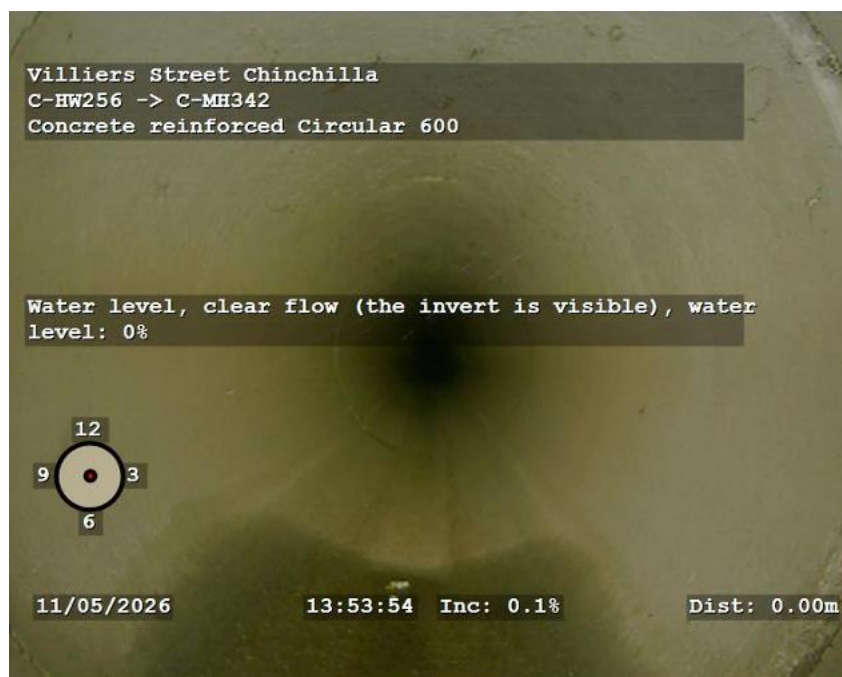

3417711052026 15355 PM.jpg, 00:00:16, 0.00
Water level, clear flow (the invert is visible), water level: 0%

Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

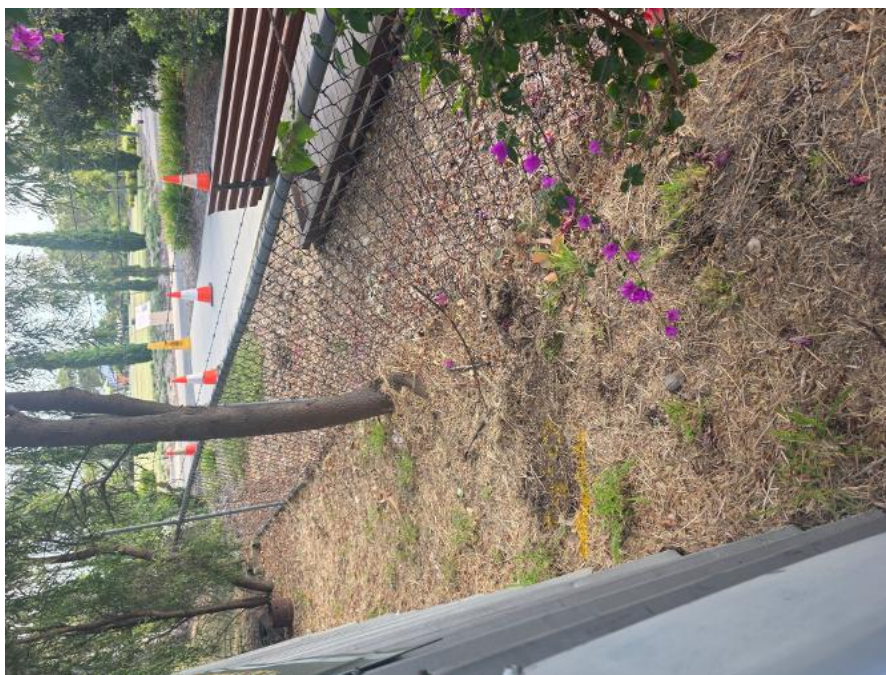

365412052026 75923 AM.jpg, 00:01:20, 3.11

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark




2750312052026 75938 AM.jpg, 00:03:51, 13.95

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location photo

Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

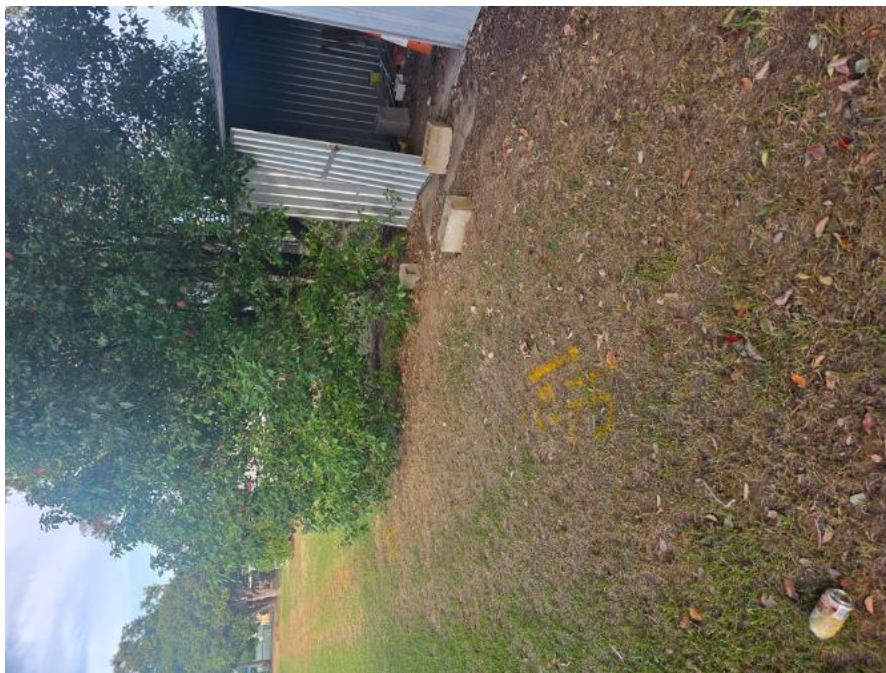

306412052026 75948 AM.jpg, 00:05:21, 20.23

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark




795312052026 75956 AM.jpg, 00:06:46, 25.21

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

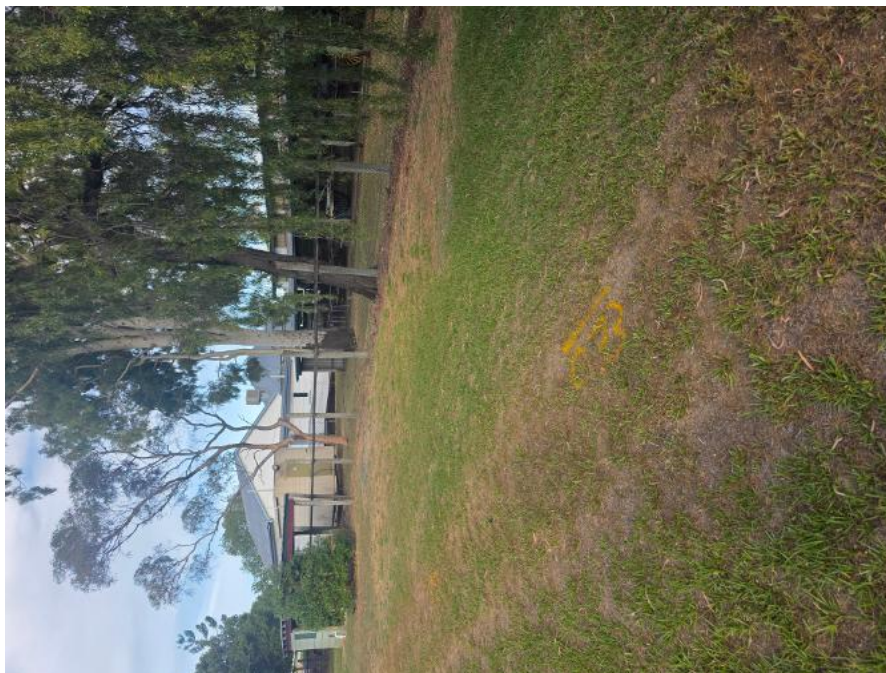

5784412052026 80002 AM.jpg, 00:07:47, 30.04

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

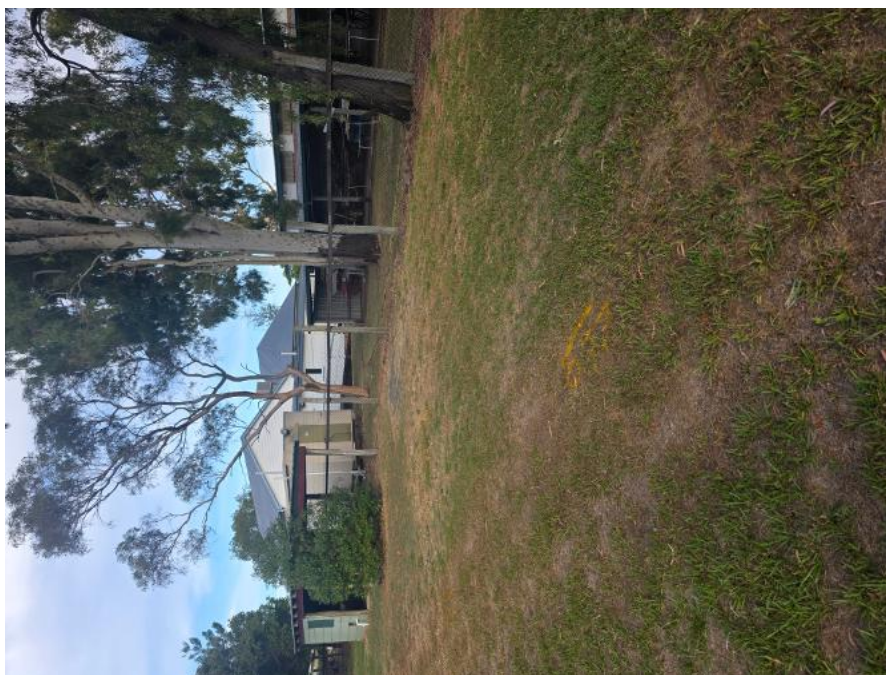

5920112052026 80008 AM.jpg, 00:08:49, 35.15

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------



4394812052026 80015 AM.jpg, 00:09:52, 39.91

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark




999312052026 80021 AM.jpg, 00:10:53, 44.87

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

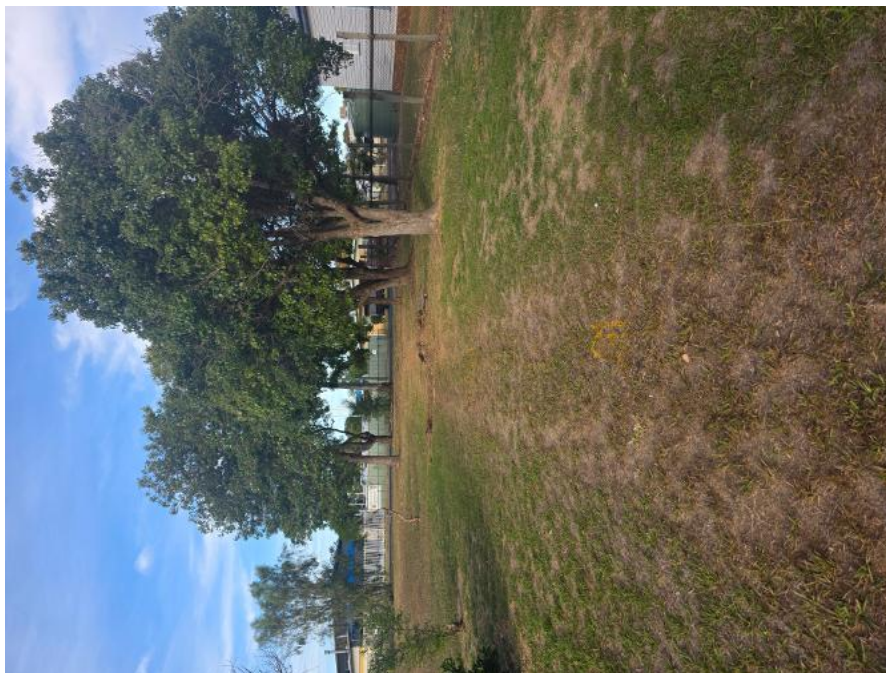

3811612052026 80033 AM.jpg, 00:11:54, 49.83

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

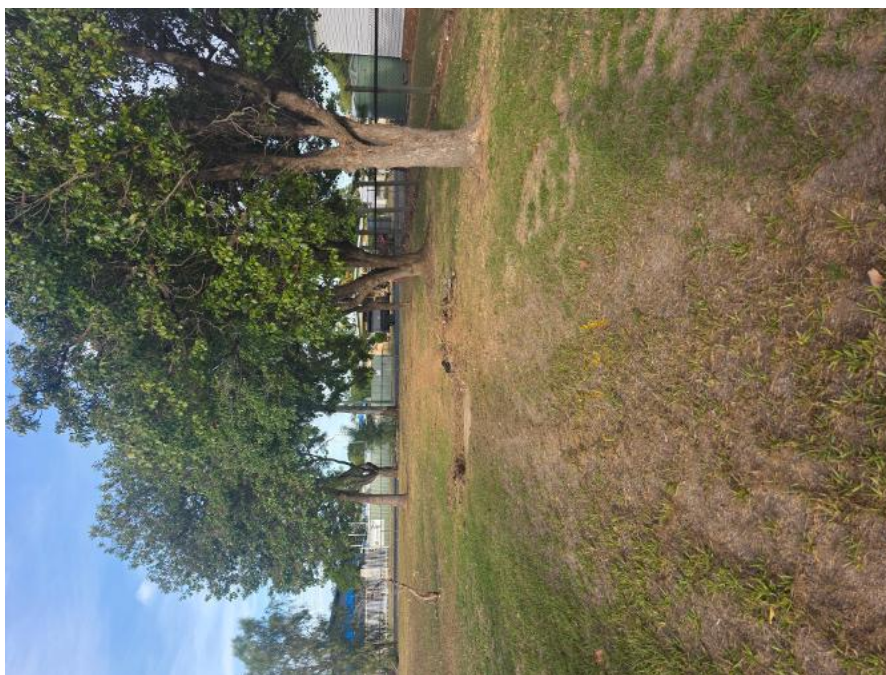


3869912052026 80039 AM.jpg, 00:13:10, 55.83

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

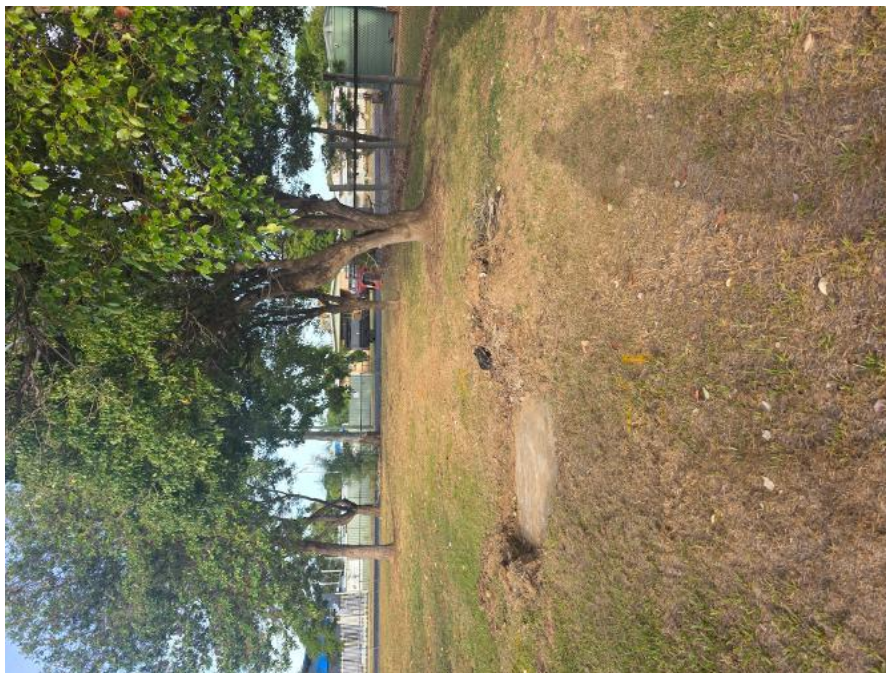

4610012052026 80045 AM.jpg, 00:14:33, 60.82

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

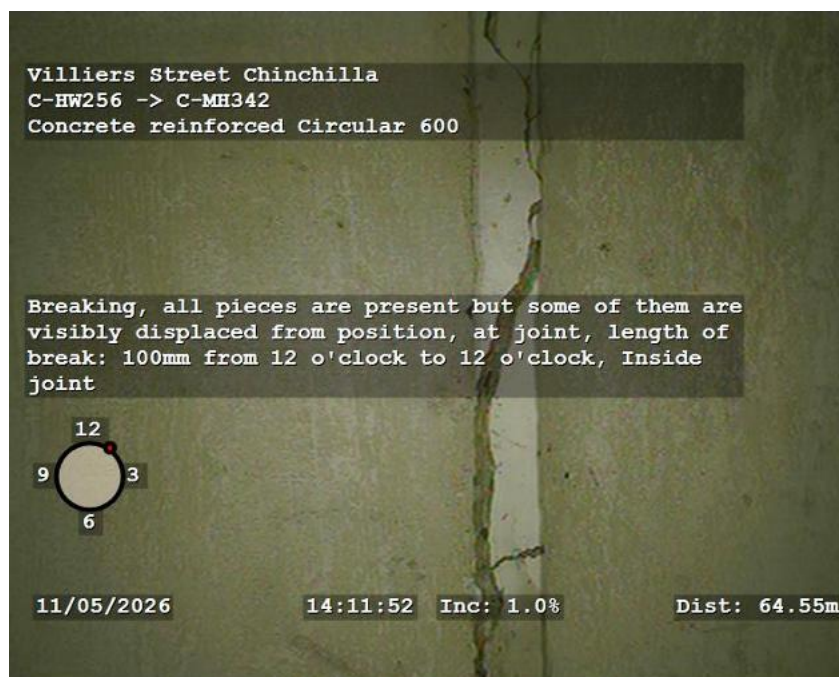


5271511052026 21153 PM.jpg, 00:15:19, 64.55

Breaking, all pieces are present but some of them are visibly displaced from position, at joint, length of break: 100mm from 12 o'clock to 12 o'clock / Inside joint


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

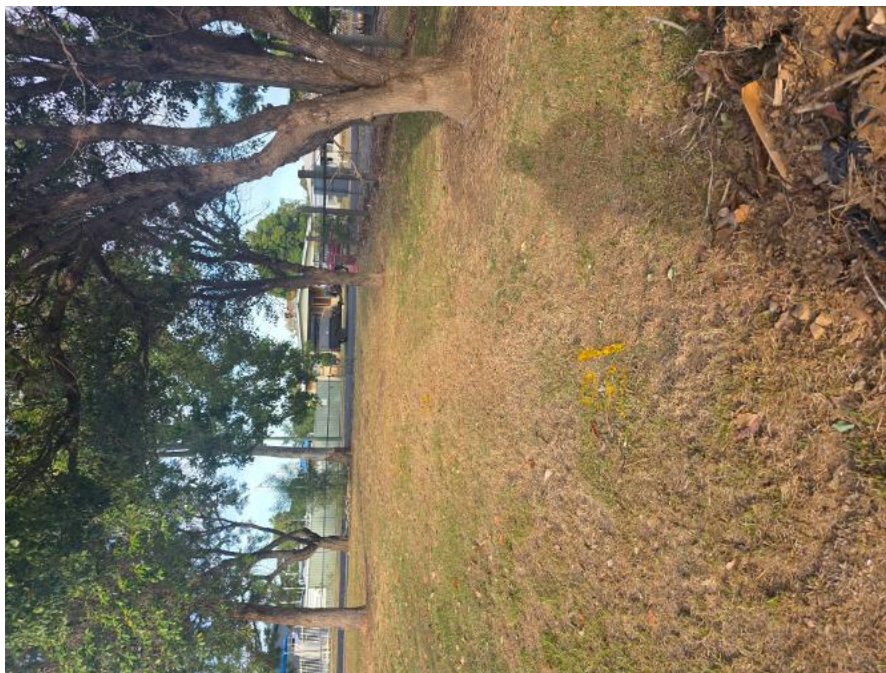

6434512052026 80052 AM.jpg, 00:15:39, 64.55

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

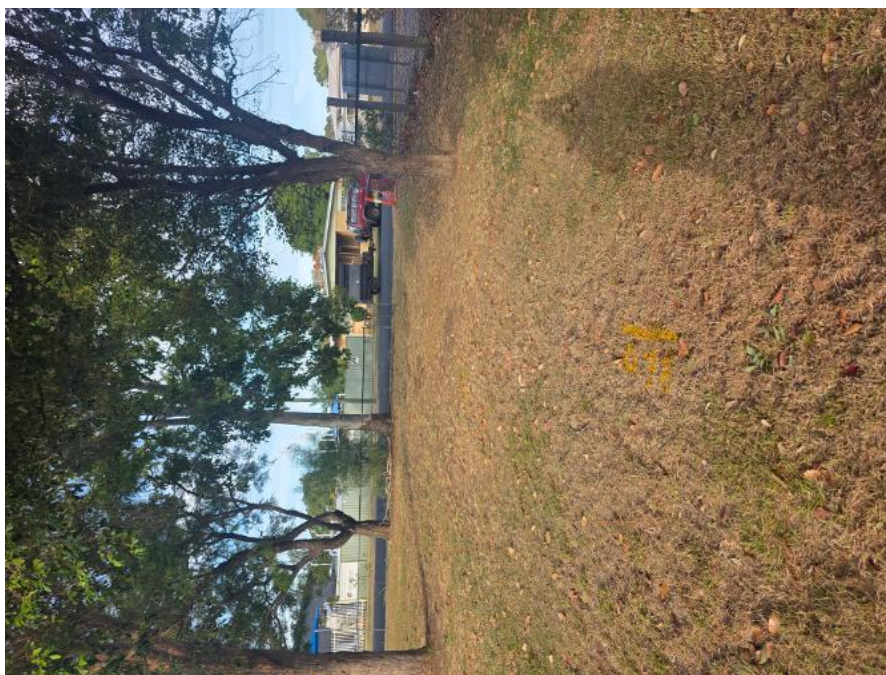


2624512052026 80058 AM.jpg, 00:16:41, 69.41

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

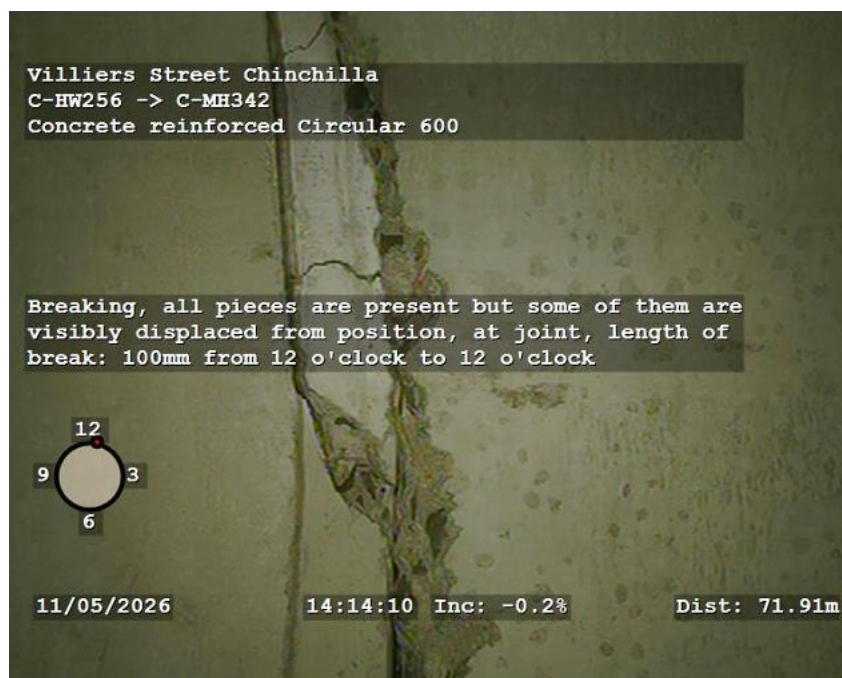

2136711052026 21411 PM.jpg, 00:17:07, 71.91

Breaking, all pieces are present but some of them are visibly displaced from position, at joint, length of break: 100mm from 12 o'clock to 12 o'clock

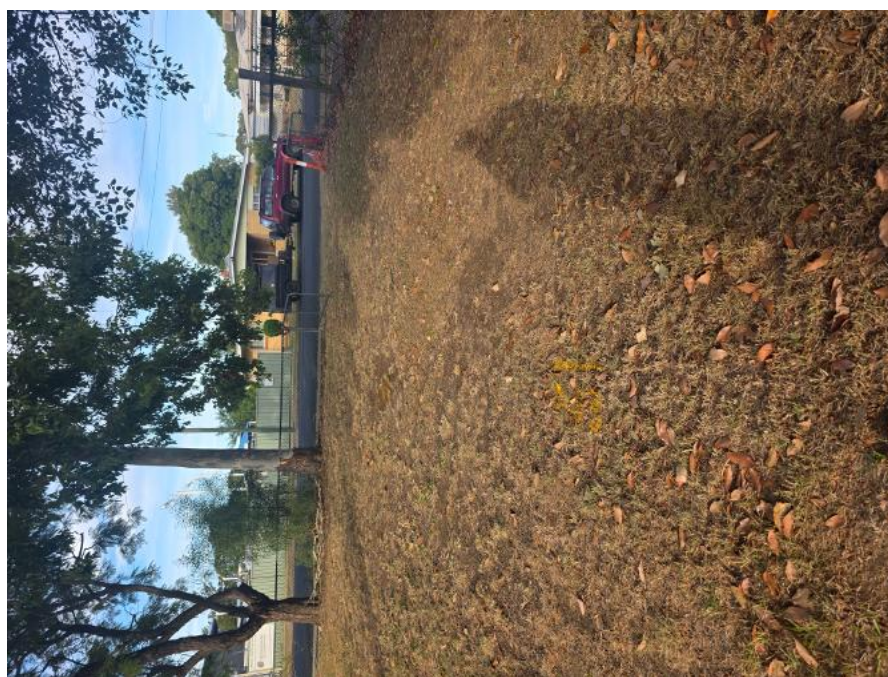


269112052026 80104 AM.jpg, 00:17:51, 74.29

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 1 o'clock / Location mark


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

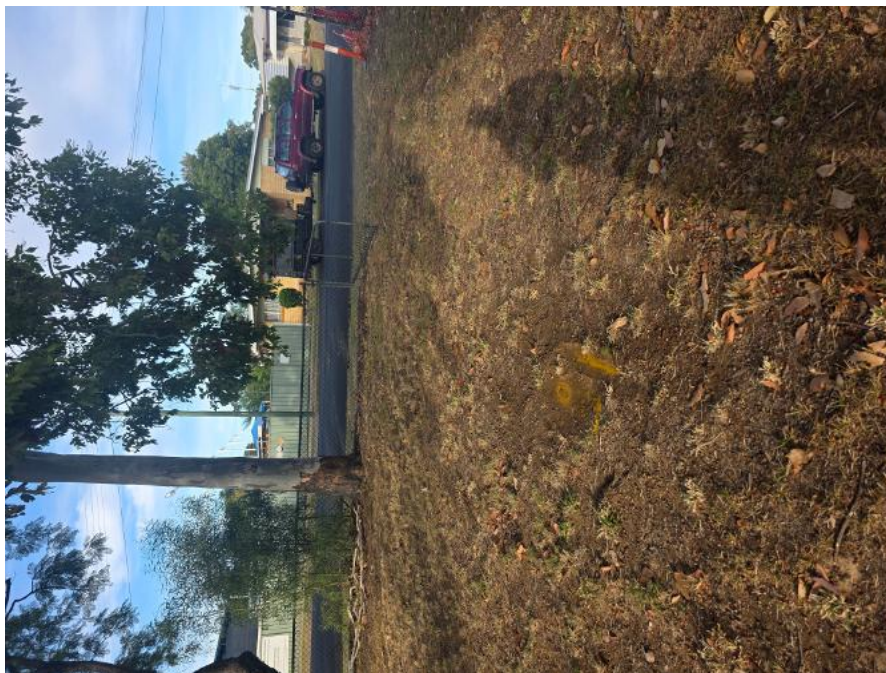

3112912052026 80110 AM.jpg, 00:18:52, 79.17

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock

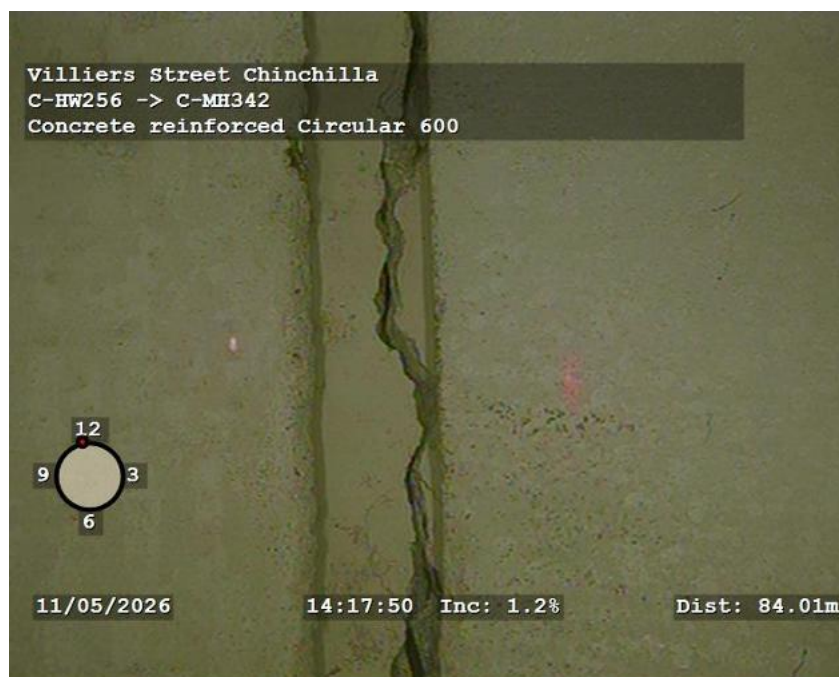


683011052026 21751 PM.jpg, 00:20:26, 84.01

Circumferential fracture, at joint, width: 2.195mm from 12 o'clock to 12 o'clock


Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------

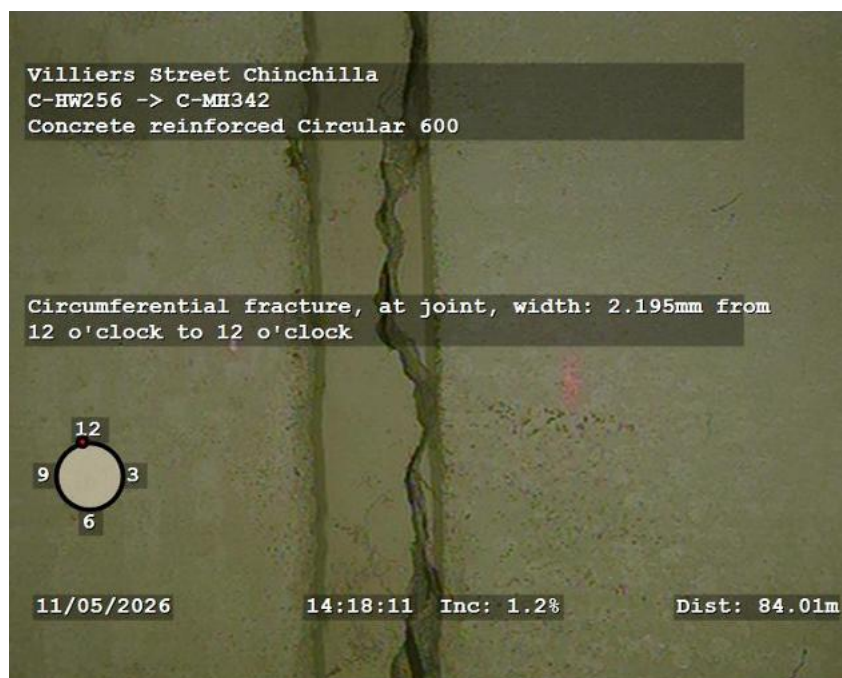

770411052026 21812 PM.jpg, 00:20:26, 84.01

Circumferential fracture, at joint, width: 2.195mm from 12 o'clock to 12 o'clock

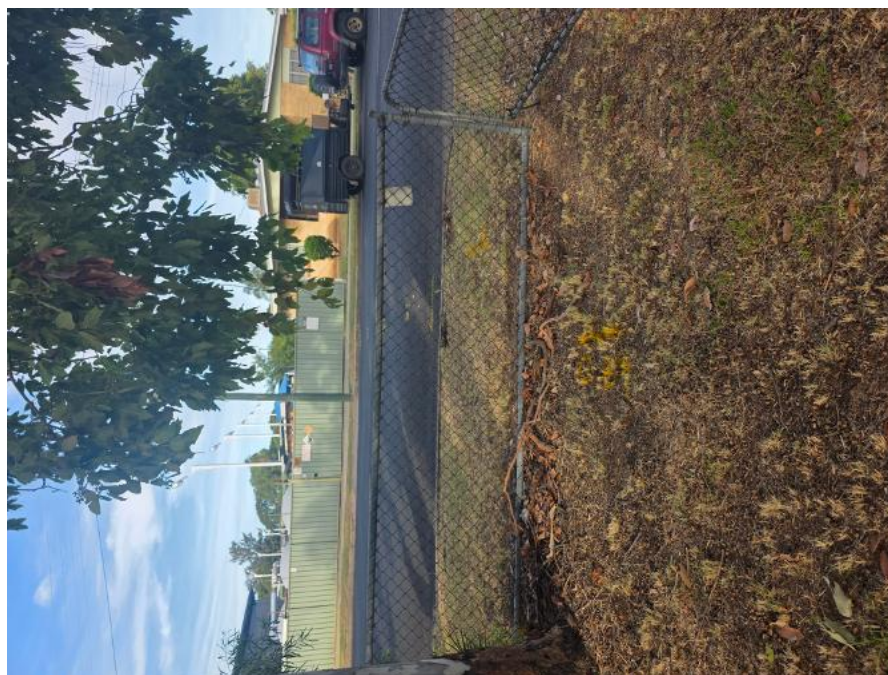

3121512052026 80118 AM.jpg, 00:20:44, 84.01

General photograph, the camera is pointing in the direction of travel (forward) and horizontally from 12 o'clock to 12 o'clock / Location mark

Section Pictures - 11/05/2026 - Unknown Chamber- C-HW256

Town	Address/Location Street	11/05/2026	Pipe Asset ID Unknown Chamber-	Job ID 01
------	----------------------------	------------	-----------------------------------	--------------



2705311052026 22222 PM.jpg, 00:23:45, 91.62

Finish node, Nodename:, Unknown Chamber / Sealed chamber with no manhole lid

Section Inclination - 11/05/2026 - Unknown

Drain Tech Australia Pty Ltd

Gold Coast, Qld

Tel. 1800 23 CCTV

info@draintechaustralia.com.au

Pipe Asset ID	Date	Time	Name of operator	Town	US Address/Location	Direction of camera	Inspected Length
Unknown Chamber- C-H	11/05/2026	1:53 PM			Street	Upstream	91.38 m
Shape	Dia/Height	Width	US MH	DS MH	Start altitude	End altitude	Measured Inc
Circular	600 mm	600 mm	Unknown chamber	C-HW256	1.496 m	0.000 m	-1.637 %

Inclination

